




510 Madera Ave.
San Jose, CA 95112
(408) 993-1900
Fax (408) 993-1944

RECEIVED & READ

[Signature] 5/18/2011
SIGNATURE DATE
[Signature] 5/18/2011
SIGNATURE DATE

Property Inspection Report

3280 Julio Avenue, San Jose, CA 95124

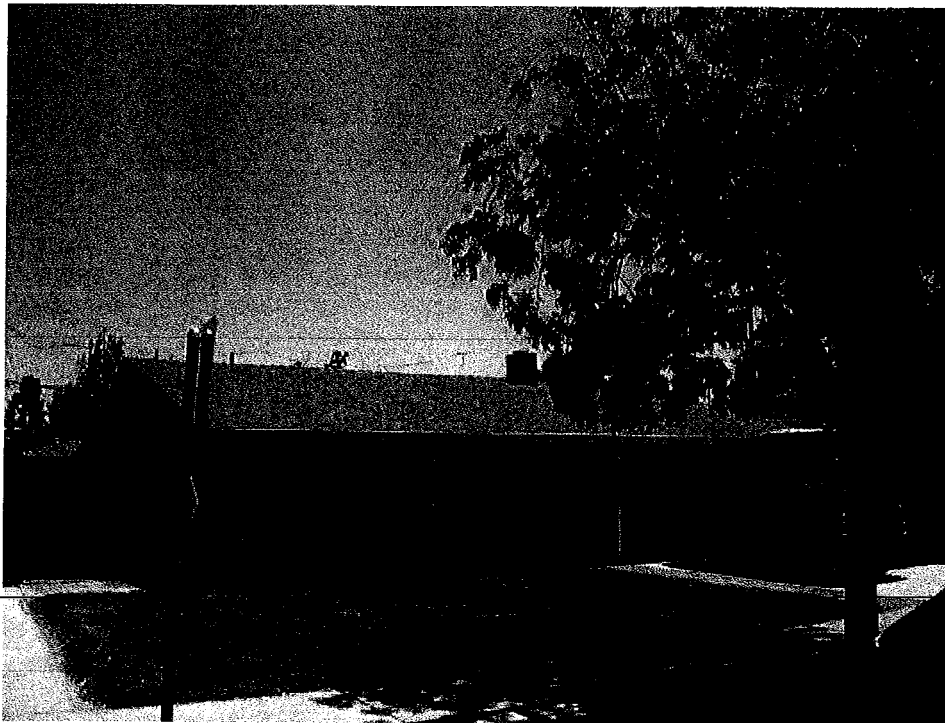

Ordered by: _____

Steve Trotter
Intero Real Estate
1900 Camden Avenue
San Jose CA 95124

Inspected by: _____

Robert Ripke
May 24, 2011
Report No. 150598

[Signature of Robert Ripke]

Table of Contents

Report Overview	3
Structure	6
Roofing	7
Exterior	8
Electrical	10
Heating System	11
Insulation/Ventilation	12
Plumbing	13
Interior	14
Pictures	16
Maintenance Advice	20

Report Overview

A GENERAL DESCRIPTION OF THE STRUCTURE

This is an average quality single family residence. Approximately 57 years old. As with all homes, ongoing maintenance is required and improvements to the systems of the home will be needed over time. The improvements that are recommended in this report are not considered unusual for a home of this age and location. Please remember that there is no such thing as a perfect home.

WEATHER CONDITIONS

Dry weather conditions prevailed at the time of the inspection.

IMMEDIATE RECOMMENDED IMPROVEMENTS

The following is a synopsis of the potentially significant improvements that should be budgeted for over the short term. Other significant improvements, outside the scope of this inspection, may also be necessary. Please refer to the body of this report for further details on these and other recommendations.

Roofing

1. The built-up/flat roofing over the patio room is past the end of its life cycle and should be replaced. There is significant deterioration throughout the field. It is recommended that roofing materials be removed prior to re-roofing. When re-roofing, it is recommended that all flashing be replaced at that time. For further evaluation of the condition of the roof we recommend you consult a licensed roofing contractor. (See Picture 1)

Exterior

2. Cracked or broken exterior window's glass at the rear patio room should be replaced. (See Picture 7)
3. Water damage was observed at the rear patio room roof eaves/sheathing. We recommend the advice and services of a general contractor and/or structural pest control company regarding repairs. (See Picture 6)
4. Water damage was observed to the front and rear beam ends. We recommend the damaged wood members be repaired or replaced as necessary. (See Picture 1) (See Picture 2) (See Picture 4) (See Picture 5)
5. Water damage was observed to the wood siding in the exterior walls by the rear patio room. We recommend the advice and services of a licensed general contractor and/or structural pest control company. (See Picture 8)
6. The door between the garage and the interior of the house should be fitted with an automatic closer mechanism. This will reduce the potential of toxic automobile gases entering the house and serves as a fire break. (See Illustration 6B)
7. Personal storage was blocking access to the interior of the garage. Therefore, the area is considered inaccessible and was not fully inspected. With access and an opportunity for complete inspection, conditions in need of attention may be discovered. Ideally, the personal belongings should be removed so the area may be inspected.
8. Cracked or broken window's glass at the middle bedroom should be replaced. (See Picture 20) (See Picture 21)

Electrical

9. Abandoned wiring was noted in the garage. We recommend the wiring be disconnected at it's source or terminated in an approved manner in a covered junction box. (See Picture 13)

Plumbing

10. The clean out cap is missing at the right. We recommend replacing the cap to prevent sewage spillage and odor. (See Picture 10)
11. The water heater vent pipe or hood is loose and exhaust leakage was evident. This is a potential safety concern that should be addressed. We recommend the vent and hood be properly installed as necessary. (See Picture 14)

Interior

12. The kitchen countertop is water damaged in the areas under and around the sink where water leakage has occurred. We recommend the advice and services of a licensed structural pest control operator for investigation and repair of this condition. (See Picture 15)
13. The wall at the patio room shows evidence of water stains. It is recommended that the source of the moisture be identified and corrected and the surface be repaired and refinished to restore its appearance. (See Picture 17)
14. The ceiling in the patio room shows evidence of water damage. We recommend the advice and services of a licensed structural pest control company for investigation and repair of this condition. (See Picture 18)

The Scope of the Inspection

All components designated for inspection in the ASHI standards of practice are inspected, except as may be noted in the "Limitations" section within the report. This inspection will not disclose compliance with regulatory requirements (codes, regulation laws, ordinances, etc.)

This inspection is visual only. Only a representative sample of the building and system components was viewed. No destructive testing or dismantling of building components was performed. The strength, adequacy, effectiveness, or efficiency of any system or components was not determined. Not all recommended improvements will be identified in this inspection. Unexpected repairs should still be anticipated. This inspection should not be considered a guarantee or warranty of any kind. The purpose of our inspection is to provide a general overview of the structure reflecting the conditions present at the time of this inspection. The inspection is performed by visual means only, reflecting only the opinions of the inspector. Nothing in the report, and no opinion of the inspector, should be construed as advice to purchase, or to not purchase, the property. It is the goal of this inspection to put the buyer in a better position to make a buying decision

Our inspection does not address, and is not intended to address, the possible presence of hazardous plants or animals or danger from known and unknown environmental pollutants such as, but not limited to, asbestos, mold, radon gas, lead, urea formaldehyde, underground storage tanks, soil contamination and other indoor and outdoor substances, water contamination, toxic or flammable chemicals, water or airborne related illness or disease, and all other similar or potentially harmful substances and conditions. This property was not inspected for the presence or absence of health related molds or fungi. We are neither qualified, authorized nor licensed to inspect for health related molds or fungi. If you desire information about the presence or absence health related molds, you should contact the appropriate specialist. Be aware that many materials used in building construction may potentially contain hazardous substances. Furthermore, other environmental concerns may exist elsewhere. An environmental specialist should be contacted if additional information is desired about these issues.

PLEASE NOTE: Important disclosure information and other inspection reports may exist. All present and prior disclosures along with other inspection reports should be reviewed and any adverse conditions and/or concerns that may not be mentioned in our report should be addressed prior to the close of escrow. Furthermore, there may be conditions known by the seller that have not been disclosed to us.

Pictures are provided to assist in clarifying some of the findings made in the report. No relative importance should be placed on these pictures. There are likely to be significant comments that do not have pictures associated with them. Please read the report thoroughly.

Structure

ITEM DESCRIPTIONS:

Attic Access Location	• Closet
Ceiling Structure	• Joist
Roof Structure	• Rafters
Roof Sheathing	• Plywood or Orientated Strand Board
Crawl Space Access	• None (Slab)
Foundation	• Slab on grade
Wall/Foundation Structure	• Wood Frame

COMMENTS:

Due to the design of this building foundation anchor bolts were concealed from view.

LIMITATIONS:

This is a visual inspection to the accessible areas only. Assessing the structural integrity of a building is beyond the scope of a typical inspection. A certified professional engineer is recommended where there are structural concerns about the building.

- Insulation within the roof attic cavity obstructed a view of structural members.
- Structural components concealed behind finished surfaces could not be inspected.
- Only a representative sampling of visible structural components was inspected.
- Furniture and/or storage restricted access to some of the structural components.

Roofing

ITEM DESCRIPTIONS:

Roof	• Composition shingle • Built Up
Chimney	• Masonry
Gutters and Downspouts	• Metal

COMMENTS:

We recommend reviewing a roof inspection report performed by a licensed roof inspector on this structure.

RECOMMENDATIONS/OBSERVATIONS - "I" indicates an immediate improvement recommendation item.

1. The chimney does not have a spark arrester or rain cap. A rain cap and/or screen should be installed on the masonry chimney. (See Illustration 3I) (See Picture 3)
- ! 2. The built-up/flat roofing over the patio room is past the end of its life cycle and should be replaced. There is significant deterioration throughout the field. It is recommended that roofing materials be removed prior to re-roofing. When re-roofing, it is recommended that all flashing be replaced at that time. For further evaluation of the condition of the roof we recommend you consult a licensed roofing contractor. (See Picture 1)

LIMITATIONS:

This is a visual inspection to the accessible areas only. Roofing life expectancies can vary depending on several factors. Any estimates on remaining life are approximations only. This assessment of the roof does not preclude the possibility of leakage. Leakage can develop at any time and may depend on rain intensity, wind direction, ice build up, etc.

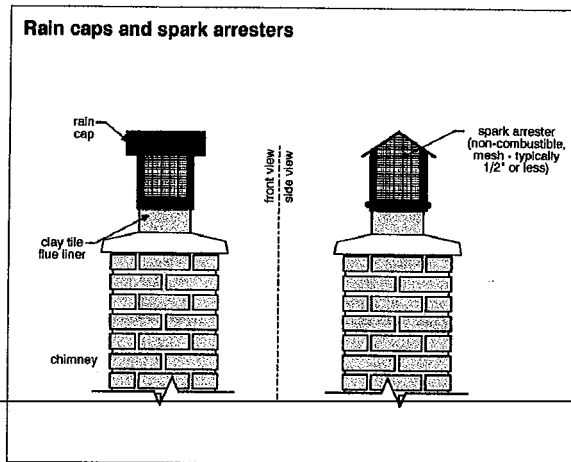


Illustration 3I

Exterior

ITEM DESCRIPTIONS:

Main Garage	• Attached
Main Garage Door/Opener	• Metal
Lot Topography	• Level grade
Driveway	• Concrete
Walkway & Sidewalks	• Concrete
Fencing/Gates	• Wood
Steps, Porch/Deck	• Concrete
Fasica, Eaves and Rafters	• Wood • Open Rafters
Exterior Walls	• Plywood or Orientated Strand Board • Stucco
Doors	• Wood • Metal

COMMENTS:

RECOMMENDATIONS/OBSERVATIONS - '!' indicates an immediate improvement recommendation item.

- ! 1. Cracked or broken window's glass at the middle bedroom should be replaced. (See Picture 20) (See Picture 21)
- ! 2. The door between the garage and the interior of the house should be fitted with an automatic closer mechanism. This will reduce the potential of toxic automobile gases entering the house and serves as a fire break. (See Illustration 6B)
- ! 3. Personal storage was blocking access to the interior of the garage. Therefore, the area is considered inaccessible and was not fully inspected. With access and an opportunity for complete inspection, conditions in need of attention may be discovered. Ideally, the personal belongings should be removed so the area may be inspected.
- ! 4. Cracked or broken exterior window's glass at the rear patio room should be replaced. (See Picture 7)
- ! 5. Water damage was observed at the rear patio room roof eaves/sheathing. We recommend the advice and services of a general contractor and/or structural pest control company regarding repairs. (See Picture 6)
- ! 6. Water damage was observed to the wood siding in the exterior walls by the rear patio room. We recommend the advice and services of a licensed general contractor and/or structural pest control company. (See Picture 8)
- ! 7. Water damage was observed to the front and rear beam ends. We recommend the damaged wood members be repaired or replaced as necessary. (See Picture 1) (See Picture 2) (See Picture 4) (See Picture 5)
8. One or more of the exterior garage passage doors have missing hardware. We recommend that hinges, knobs, latches and strike plates be adjusted or replaced to restore full operation. (See Picture 12)

LIMITATIONS:

This is a visual inspection to the accessible areas only.

- A representative sample of exterior components was inspected.
- The inspection does not include an assessment of geological conditions, site stability and property surface drainage runoff.


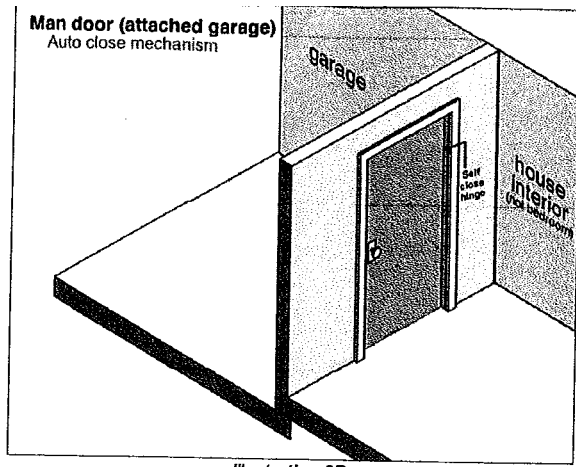


Illustration 6B

 

Electrical

ITEM DESCRIPTIONS:

Service	• 120/240 volt main service
Service Entrance	• Overhead Service Wires
Service Ground	• Copper Ground Wire
Main disconnect	• Breakers • Main Service Rating: 100 Amps
Main Distribution Panel	• Breakers
Distribution Wiring	• Copper Wire
Outlets	• Grounded/Ungrounded
Ground Fault Circuit Interrupters	• Bathroom

COMMENTS:

The size of the electrical service is sufficient for typical single family needs.

The distribution of electricity within the home is good.

Dedicated 240 volt circuits have been provided for all 240 volt appliances within the home.

RECOMMENDATIONS/OBSERVATIONS - '!' indicates an immediate improvement recommendation item.

- ! 1. Abandoned wiring was noted in the garage. We recommend the wiring be disconnected at it's source or terminated in an approved manner in a covered junction box. (See Picture 13)
2. Loose wiring in various locations of the garage should be improved by securing it to the framing. (See Picture 23)

MAINTENANCE ITEMS & GENERAL INFORMATION

3. One or more of the circuit breakers within the main electrical panel are not of the same manufacture as the panel. Due to the age of the panel, original manufacture circuit breakers may not be readily available. Since no obvious conditions are noted in regards to this condition replacement would be optional. (See Picture 11)

LIMITATIONS:

This is a visual inspection to the accessible areas only. The inspection does not include (if applicable) low voltage systems, telephone wiring, intercoms, alarm systems, TV cable, timers, central vacuum systems, exterior sprinkler systems, exterior landscape lighting or exterior motion sensor lights. Also smoke detectors out of reach were only visually inspected unless noted otherwise. We recommend these systems be checked by interested parties for proper operation when possible.

- Due to inaccessibility of concealed wiring or undocumented improvements of the structure, we are unable to predict whether the number of circuits within a home will be sufficient for the needs of the occupants during a typical home inspection. If fuses blow (or breakers trip) regularly, this may indicate that additional loads or remodeling modifications may have been added to existing circuits. It does not indicate that your electrical service is undersized, nor does it represent a safety concern.
- Electrical components concealed behind finished surfaces could not be inspected.
- According to "ASHI" standards and due to time limitations and/or owner furniture only a representative sampling of outlets and light fixtures were tested.
- Furniture and/or storage (if applicable) may of restricted access to some electrical components.

Heating System

ITEM DESCRIPTIONS:

Primary Energy Source • Gas
Heating System Type • Forced Air • Manufacturer: Williams • BTU's: 35,000 • Location: Hall

COMMENTS:

Due to owner furniture or storage, inspection of the heating unit in the patio room was restricted. We recommend inspection of the heater components when access is provided. For additional information we recommend the services of a licensed heating contractor. (See Picture 19)

The heating system which was operated at the time of our inspection shows no visible evidence of major defects.

LIMITATIONS:

This is a visual inspection to the accessible areas only. The inspection of the heating system is general and not technically exhaustive. A detailed evaluation of the furnace heat exchanger is beyond the scope of this inspection.

- Determining furnace heat supply adequacy or inadequacy, distribution balance or sizing of the unit or units is not a part of this inspection.
- The wall mount and/or window mounted air conditioning unit (if applicable) was not inspected and are excluded from this report.
- Heating and/or air conditioning registers where accessible were visually inspected. Manual operation of the registers was not performed.
- The heat exchanger of the furnace was not inspected and interior portions of the heater were restricted. For additional information we recommend the services of a licensed heating contractor. As a free public service, the local utility company (PG&E) will perform a "safety" review of the heat exchanger and other gas operated components. We recommend that you take advantage of this service before the next seasonal operation.
- Inspection of the heater and/or air conditioner thermostat is limited to operating the units(s) on and off function only. Testing of the thermostat timer, temperature accuracy, clock, set back functions, etc. were not performed.

Insulation/Ventilation

ITEM DESCRIPTIONS:

Attic/Roof Insulation	• Cellulose • Depth in inches: 10
Attic/Roof Ventilation	• Roof Vents • Fascia vents
Exterior Walls Insulation	• Unknown

COMMENTS:

Insulation levels are typical for a home of this age and construction.

LIMITATIONS:

This is a visual inspection to the accessible areas only.

- Insulation/ventilation type and levels in concealed areas cannot be determined. No destructive tests were performed.
- Potentially hazardous materials such as Asbestos and Urea Formaldehyde Foam Insulation (UFFI) cannot be positively identified without a detailed inspection and laboratory analysis. This is beyond the scope of the inspection.
- An analysis of indoor air quality is beyond the scope of this inspection.
- Any estimates of insulation R values or depths are rough average values.

Plumbing

ITEM DESCRIPTIONS:

Water Supply Source	• Public
Service Pipe	• Copper Pipe
Main Water Valve Location	• Exterior Front
Supply Piping	• Copper Pipe
Waste Disposal System	• Public
Drain/Waste/Vent	• Plastic
Cleanout Location	• Exterior
Water Heaters	• Manufacturer: Kenmore • Capacity: 40 Gallons • Approximate Age: 8 Year(s) • Gas • Location: Garage
Seismic Gas Shut-off	• Not Present
Excess Flow Gas Shut-off	• Not Present

COMMENTS:

Due to the design of this unit/building, most of the supply piping was inaccessible for inspection. For additional information, we recommend a licensed plumbing contractor be consulted.

The plumbing system appears to be in good condition.

RECOMMENDATIONS/OBSERVATIONS - '!' indicates an immediate improvement recommendation item.

- ! 1. The clean out cap is missing at the right. We recommend replacing the cap to prevent sewage spillage and odor. (See Picture 10)
- ! 2. The water heater vent pipe or hood is loose and exhaust leakage was evident. This is a potential safety concern that should be addressed. We recommend the vent and hood be properly installed as necessary. (See Picture 14)

LIMITATIONS:

This is a visual inspection to the accessible areas only.

- Water and gas shut-off valves, including but not limited to seismic, excess flow shut-off valves and gas fireplace valves where applicable, were not operated or tested. Identification of these devices is limited to the accessible areas only.
- Portions of the plumbing system concealed by finishes and/or storage (below sinks, below the structure and beneath the yard) were not inspected.
- Water pressure and water quality is not tested. The effect of lead content in solder and/or supply lines is beyond the scope of the inspection.
- Inspection of any water conditioning system (filters, purifiers, softeners, etc.) is beyond the scope of this inspection and are excluded from this report.
- Inspection of any lawn sprinkler system is beyond the scope of this inspection and are excluded from this report (unless noted otherwise).
- The interior portions of the water heater were restricted. For additional information we recommend the services of a licensed plumbing contractor. As a free public service, the local utility company (PG&E) will perform a "safety" review of the interior of the water heater and other gas operated components. We recommend that you take advantage of this service before the next seasonal operation.

Interior

ITEM DESCRIPTIONS:

Laundry Facilities/ hookup	• 120 Volt Circuit for Washer • Hot and Cold Water Supply for Washer • Waste Standpipe for Washer
Wall Finishes	• Drywall/Plaster
Ceiling Finishes	• Drywall/Plaster
Floor	• Carpet • Tile/Stone
Doors	• Hollow Core • Solid Core • Raised Panel
Window style and Glazing	• Sliders • Double Pane
Fireplace/Wood Stove	• None
Other Componets Tested	• Smoke Detector • Door Bell

COMMENTS:

Generally speaking, the bathroom(s) are in good condition.

On the whole, the interior finishes of the home are considered to be in average condition. Typical flaws were observed in some areas.

The doors and windows are of average quality.

RECOMMENDATIONS/OBSERVATIONS - '!' indicates an immediate improvement recommendation item.

INTERIOR

- ! 1. The ceiling in the patio room shows evidence of water damage. We recommend the advice and services of a licensed structural pest control company for investigation and repair of this condition. (See Picture 18)
2. The kitchen window side walls are damaged. We recommend they be repaired or replaced. (See Picture 22)
- ! 3. The wall at the patio room shows evidence of water stains. It is recommended that the source of the moisture be identified and corrected and the surface be repaired and refinished to restore its appearance. (See Picture 17)

KITCHEN

- ! 4. The kitchen countertop is water damaged in the areas under and around the sink where water leakage has occurred. We recommend the advice and services of a licensed structural pest control operator for investigation and repair of this condition. (See Picture 15)
5. Cracked, deteriorated and/or missing caulk at the kitchen countertop backsplash should be replaced. A flexible caulking material is recommended rather than rigid cementitious grout. (See Picture 16)

OTHER/MISC.

6. ENVIROMENTAL ISSUES:

Issues Based on the age of this home, there is a possibility the structure may contain asbestos such as ceiling texture, insulation on the distribution piping and/or transit piping and siding. This can only be verified by laboratory analysis. The Environmental Protection Agency (E.P.A.) reports that asbestos represents a health hazard if "friable" damaged, crumbling, or in any state that allows the release of fibers. If replacement necessitates the removal of the acoustic ceiling or insulation, a specialist should be engaged. If any sections of this insulation are indeed friable, or become friable over time, a specialist should be engaged. Further guidance is available from the Environmental Protection Agency (E.P.A.). Due to the age of construction, it is likely that other materials within the home that contain asbestos but are not identified by this inspection report.

7. Carbon monoxide is a colorless, odorless gas that can result from a faulty fuel burning furnace, range, water heater, space heater or wood stove. Proper maintenance of these appliances is the best way to reduce the risk of carbon monoxide poisoning. For more information, consult the Consumer Product Safety Commission CPSC at 1-800-638-2772 for further guidance. It would be wise to consider the installation of carbon monoxide detectors within the home.

MAINTENANCE ITEMS & GENERAL INFORMATION

INTERIOR

8. The evaluation of the thermal pane windows ("dual pane/glazed") is limited to accessible windows exhibiting noticeable conditions at the time of our inspection, such as condensation and/or evidence of moisture developing between the panes of glass. Due to the known design and/or characteristics associated with thermal pane windows, conditions may be discovered at a later date, however seal failure can occur at any time.


LIMITATIONS:

This is a visual inspection to the accessible areas only. Assessing the quality of interior finishes is highly subjective. Issues such as cleanliness, cosmetic flaws, quality of materials, architectural appeal and color are outside the scope of this inspection. Comments are general, except where functional concerns exist. Due to texturing and painting of interior surfaces there is no possible way of determining point of origin of any gypsum (sheetrock) material without destructive testing. HomeGuard Incorporated does not perform any destructive testing.


- Furniture, storage, appliances and/or wall hangings restricted the inspection of the interior.
- No access was gained to the wall cavities of the home.
- Kitchen appliances were operated unless noted otherwise. However they were not inspected for installation according to manufacturer specifications and were not evaluated for performance, efficiency or adequacy during their operation.
- All appliances not "built in" to the structure such as washing machine, dryer, refrigerator and/or countertop microwaves were not inspected and are excluded from this report.
- Fireplace screens or doors were not inspected and are excluded from this report

Pictures


Pictures are provided to assist in clarifying some of the findings made in this report. No relative importance should be placed on these pictures. The pictures in this report do not necessarily illustrate all of the damage as outlined in this report. Please contact the inspector if you have specific questions.

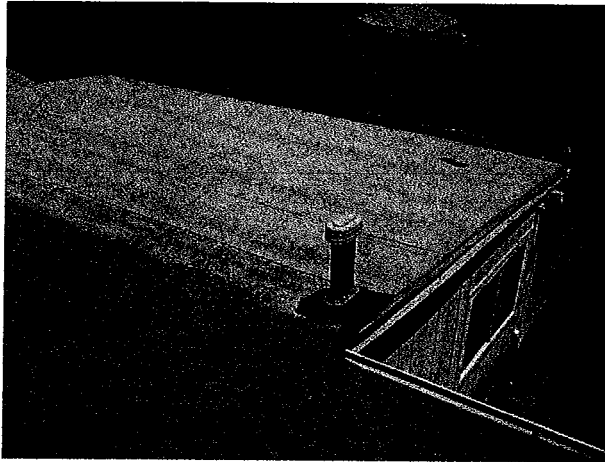


Picture 1

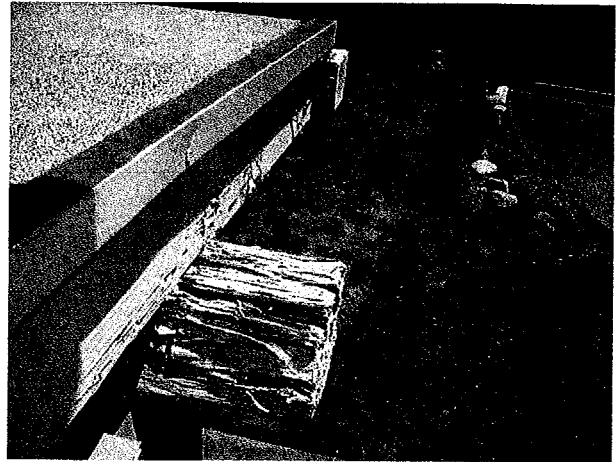


Picture 2

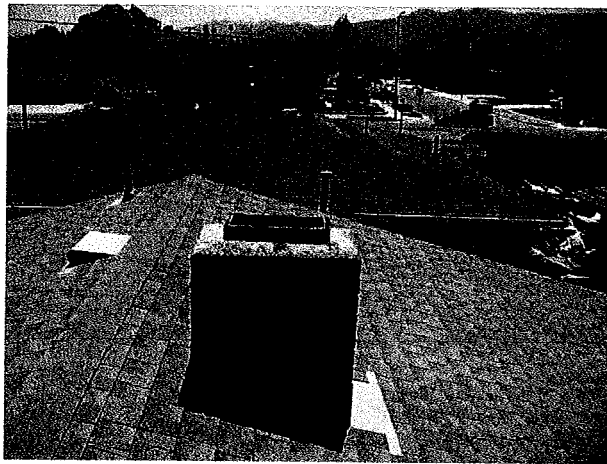


Picture 3

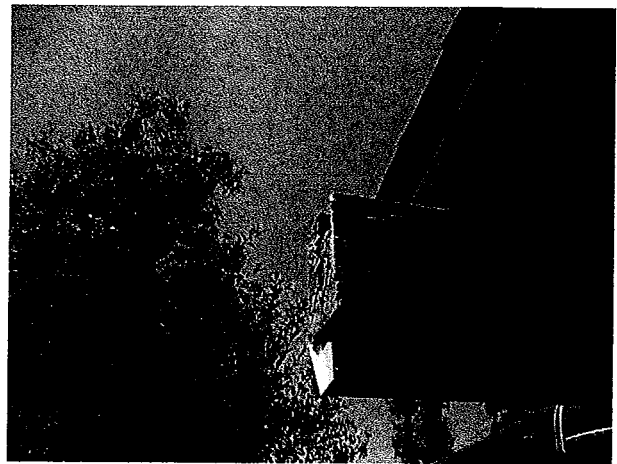


Picture 4

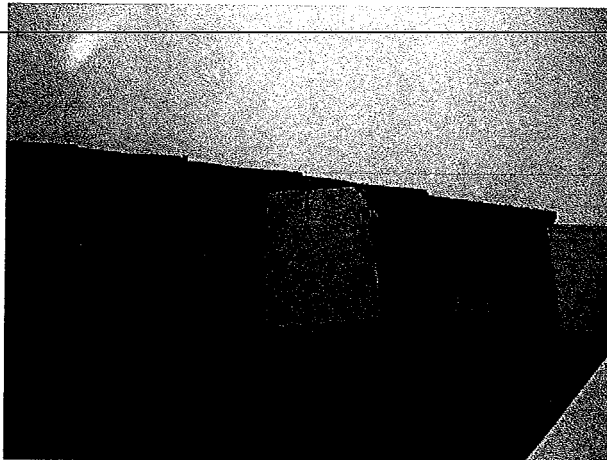

Picture 5

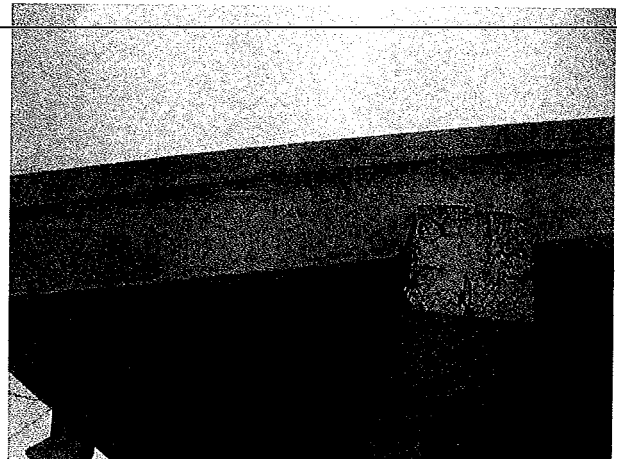

Picture 6

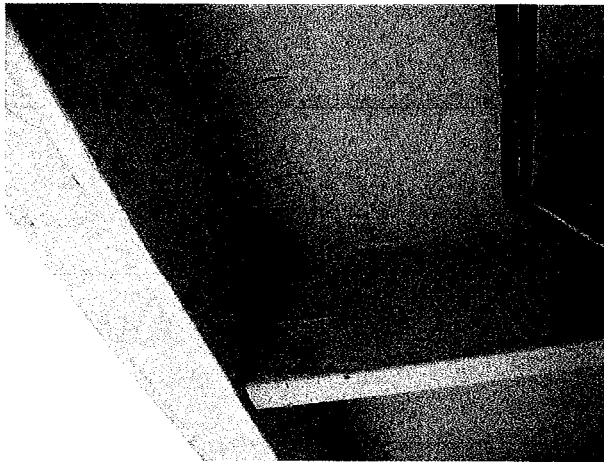


Picture 7




Picture 8



Picture 9

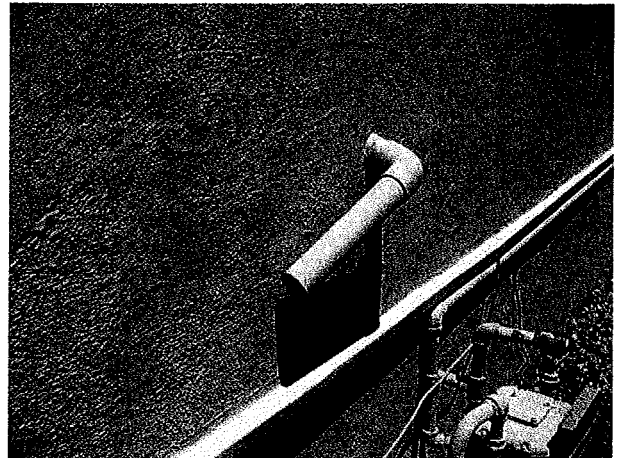


Picture 10

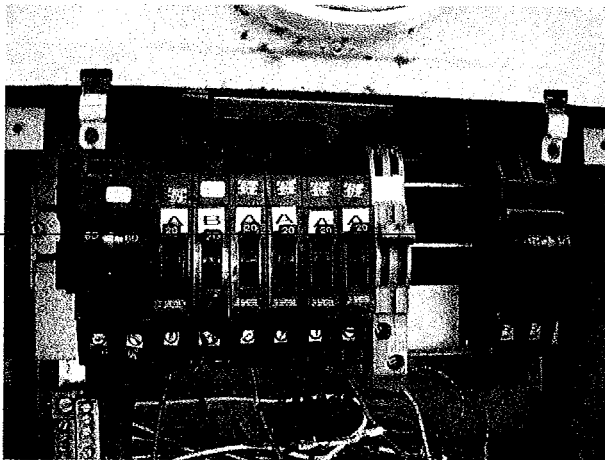


Picture 11




Picture 12

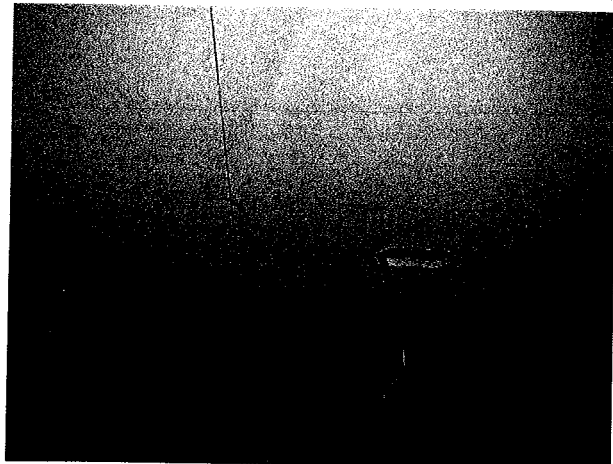


Picture 13

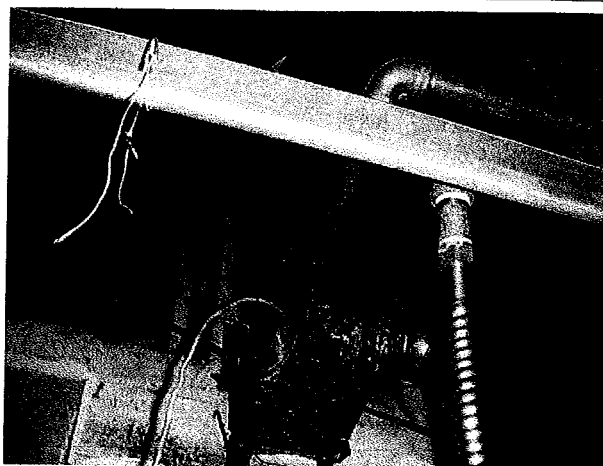


Picture 14

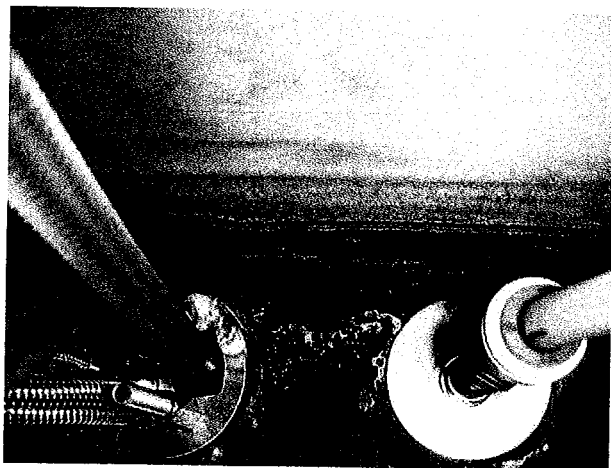


Picture 15

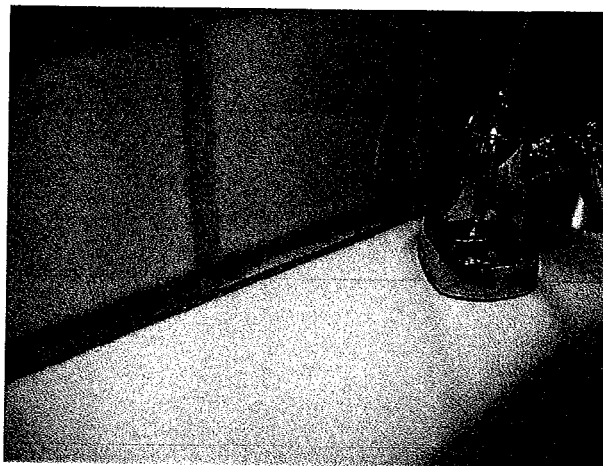


Picture 16

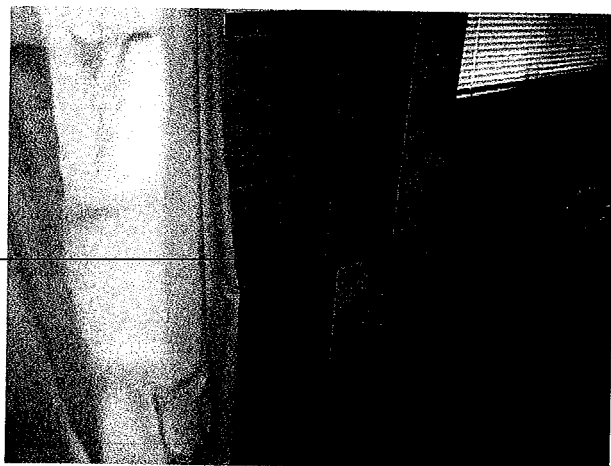


Picture 17

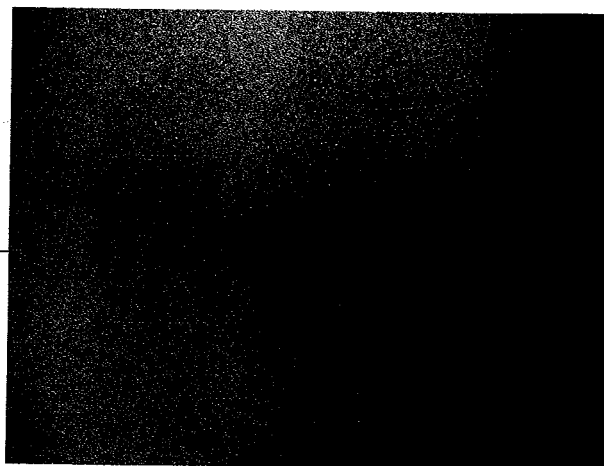


Picture 18

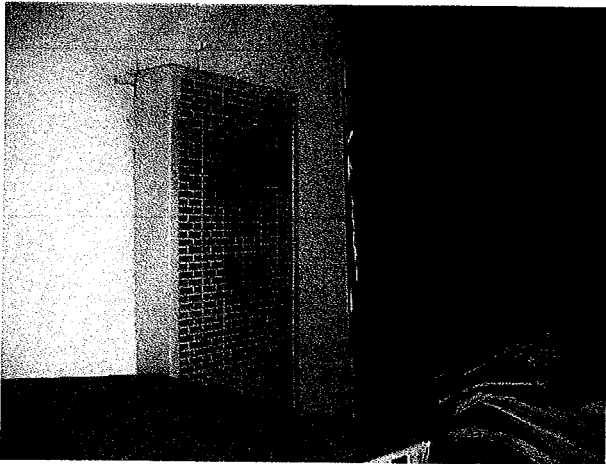


Picture 19

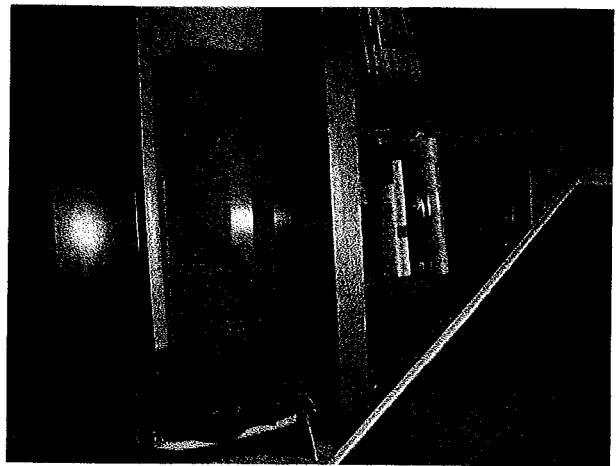

Picture 20

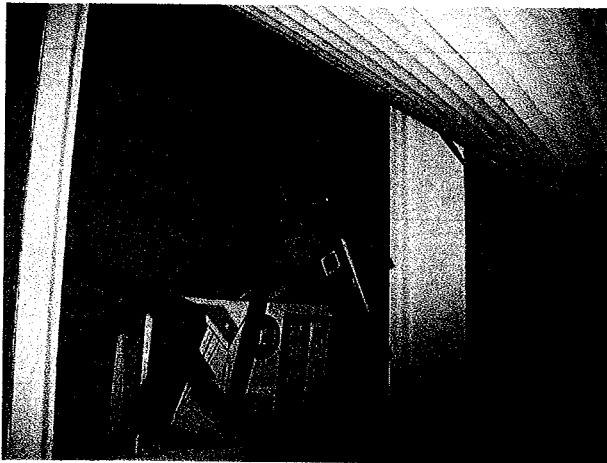

Picture 21

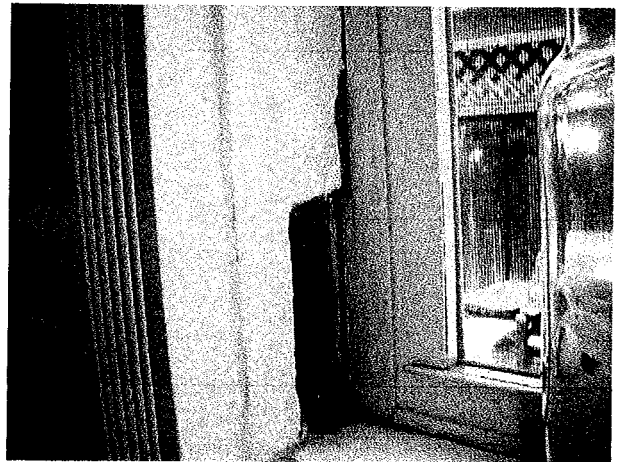

Picture 22



Picture 23

Maintenance Advice

UPON TAKING OWNERSHIP

After taking ownership of a new home, there are some maintenance and safety issues that should be addressed immediately. The following checklist should help you undertake these improvements.

- Change the locks on all exterior entrances, for improved security.
- Check that all windows and doors are secure. Improve window hardware as necessary. Security rods can be added to sliding windows and doors. Considerations could also be given to a security system.
- Install smoke detectors on each level of the home. Ensure that there is a smoke detector outside all sleeping areas. Replace batteries on any existing smoke detectors and test them. Make a note to replace batteries again in one year.
- Create a plan of action in the event of a fire in your home. Ensure that there is an operable window or door in every room of the house. Consult with your local fire department regarding fire safety issues and what to do in the event of a fire.
- Examine driveways and walkways for trip hazards. Undertake repairs where necessary.
- Examine the interior of the home for trip hazards. Loose or torn carpeting and flooring should be repaired.
- Undertake improvements to all stairways, decks, porches and landings where there is a risk of falling or stumbling.
- Review your home inspection report for any items that require immediate improvement or further investigation. Address these areas as required.
- Install rain caps and vermin screens on all chimney flues, as necessary.
- Investigate the location of the main shut-offs for the plumbing, heating and electrical systems. If you attend the home inspection, these items have been pointed out to you.

REGULAR MAINTENANCE

EVERY MONTH

- Check that fire extinguisher(s) are fully charged. Re-charge if necessary.
- Examine heating/cooling air filters and replace or clean as necessary.
- Inspect and clean humidifiers and electronic air cleaners.
- If the house has hot water heating, bleed radiator valves.
- Clean gutters and downspouts. Ensure that downspouts are secure, and that the discharge of the downspouts is appropriate. Remove debris from window wells.
- Carefully inspect the condition of shower enclosures. Repair or replace deteriorated grout and caulk. Ensure that water is not escaping the enclosure during showering. Check below all plumbing fixtures for evidence of leakage.
- Repair or replace leaking faucets or shower heads.
- Secure loose toilets, or repair flush mechanisms that become troublesome.

SPRING AND FALL

- Examine the roof for evidence of damage to roof covering, flashings and chimneys.
- Look in the attic (if accessible) to ensure that roof vents are not obstructed. Check for evidence of leakage, condensation or vermin activity. Level out insulation if needed.
- Trim back tree branches and shrubs to ensure that they are not in contact with the house.
- Inspect the exterior walls and foundation for evidence of damage, cracking or movement. Watch for bird nests or other vermin or insect activity.
- Survey the basement and/or crawl space walls for evidence of moisture seepage.
- Look at overhead wires coming to the house. They should be secure and clear of trees or other obstructions.
- Ensure that the grade of the land around the house encourages water to flow away from the foundation.

- Inspect all driveways, walkways, decks, porches, and landscape components for evidence of deterioration, movement or safety hazards.
- Clean windows and test their operation. Improve caulking and weather-stripping as necessary. Watch for evidence of rot in wood windows frames. Paint and repair window sills and frames as necessary.
- Test all ground fault circuit interrupter (GFCI) devices, as identified in the inspection report.
- Shut off isolating valves for exterior hose bibs in the fall, if below freezing temperatures are anticipated.
- Test the Temperature and Pressure Relief (TPR) Valve on water heaters.
- Inspect for evidence of wood boring insect activity. Eliminate any wood/soil contact around the perimeter of the home.
- Test the overhead garage door opener, to ensure that the auto-reverse mechanism is responding properly. Clean and lubricate hinges, rollers and tracks on overhead doors.
- Replace or clean exhaust hood filters.
- Clean, inspect and/or service all appliances as per the manufacturer's recommendations.

ANNUALLY

- Replace smoke detector batteries.
- Have the heating, cooling and water heater systems cleaned and serviced.
- Have chimneys inspected and cleaned. Ensure that rain caps and vermin screens are secure.
- Examine the electrical panels, wiring and electrical components for evidence of overheating. Ensure that all components are secure. Flip the breakers on and off to ensure that they are not sticky.
- If the house utilizes a well, check and service the pump and holding tank. Have the water quality tested. If the property has a septic system, have the tank inspected (and pumped as needed).
- If your home is in an area prone to wood destroying insects (termites, carpenter ants, etc.), have the home inspected by a licensed specialist. Preventive treatments may be recommended in some cases.

PREVENTION IS THE BEST APPROACH

Although we've heard it many times, nothing could be more true than the old cliché "an ounce of prevention is worth a pound of cure." Preventative maintenance is the best way to keep your house in great shape. It also reduces the risk of unexpected repairs and improves the odds of selling your house at fair market value, when the time comes. Please feel free to contact our office should you have any questions regarding the operation or maintenance of your home. Enjoy your home!



Invoice

Invoice Date: **5/25/2011**

Invoice No: **SJ296769P**

Bill To:	
Robin Primeau Old Republic Title 2110 S. Bascom Avenue #102 Campbell Ca 95008	
Property Information:	
Address:	3280 Julio Avenue San Jose CA, 95124
Report No:	150598 TPR
Escrow#:	none given
Billing Information:	
Inspection:	5/24/2011 Original \$455.00
Total Due:	\$455.00

DUE UPON RECEIPT
Please remit to 510 Madera Ave., San Jose, CA 95112
There is a \$25 fee for all returned checks